

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2014

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	10/14/2014 10/14/2014	Matthew Hoffman

LM Start		Rating **	A	Issue No.	6
LM End		Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_NA0006_01_s_2013_6				
Action/Comments					
Inspector Comments: The LMA has stated in the past that they do have access to flood fight supplies.					

No Photos

LM Start		Rating **	M	Issue No.	9
LM End		Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training			°	°
				°	°
DWR ID	DWR_NA0006_01_s_2012_9				
Action/Comments					
Inspector Comments: The LMA does not regularly attend Flood Fight classes put on by DWR.					

No Photos

LM Start		Rating **	M	Issue No.	10
LM End		Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_NA0006_01_s_2012_10				
Action/Comments					
Inspector Comments: No manual was available during the inspection.					

No Photos

*** Location**
 LS : Land Side N/A : Not Applicable
 WS : Water Side
 CR : Crown

**** Rating**
 A : Acceptable
 M : Minimally Acceptable
 U : Unacceptable
 N : Not Inspected/Rated
 C : Corrected
 A/W : Acceptable but Monitor & Maintain

+ Issue Type
 Ma : Maintenance Deficiency
 Ob : Design & System Obsolescence
 En : Enforcement

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2014

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	10/14/2014 10/14/2014	Matthew Hoffman

LM Start	0.01	Rating **	U	Issue No.	1
LM End	1.50	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298521 °	39.295267 °
				-121.569497 °	-121.546559 °
DWR ID	DWR_NA0006_01_s_2012_1				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					

Photo 1 of 2 : FA_2014_NA0006_252_1_20141013_00001.jpg



This photo was taken from the levee crown facing east looking at typical vegetation on both the landward and waterward levee slopes. Spring 2014.

LM Start	0.01	Rating **	U	Issue No.	1 (cont)
LM End	1.50	Issue Type +	Ma	Location *	LS

Photo 2 of 2 : FA_2014_NA0006_252_1_20141013_00002.jpg



This photo shows the landside of the levee at levee mile 0.10.

LM Start	0.05	Rating **	U	Issue No.	3
LM End	1.50	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298849 °	39.295267 °
				-121.569419 °	-121.546560 °
DWR ID	DWR_NA0006_01_s_2012_3				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					

Photo 1 of 1 : FA_2014_NA0006_252_3_20141013_00003.jpg



This photo was taken from the levee crown facing east looking at the vegetation on both the landward and waterward levee slopes.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2014

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	10/14/2014 10/14/2014	Matthew Hoffman

LM Start	0.24	Rating **	U	Issue No.	16
LM End	0.24	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.298786 °	39.298786 °
				-121.566159 °	-121.566159 °
DWR ID	DWR_NA0006_01_f_2014_16				
Action/Comments					
Thin trees to allow visibility of the ground and room to flood fight. Inspector Comments: Trees should be trimmed up or removed to maintain visibility of landward levee slope.					

Photo 1 of 1 : FA_2014_NA0006_252_16_20141017_00012.jpg



This photo was taken from the crown facing west looking down the landward levee slope at trees that either need to be trimmed up or removed to provide slope visibility. Fall 2014.

LM Start	0.46	Rating **	U	Issue No.	15
LM End	0.46	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298283 °	39.298283 °
				-121.562021 °	-121.562021 °
DWR ID	DWR_NA0006_01_f_2014_15				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Berry bushes on waterward levee slope need to be trimmed back.					

Photo 1 of 1 : FA_2014_NA0006_252_15_20141017_00011.jpg



This photo was taken from the crown facing west looking down the waterward levee slope at berry bushes needing removal. Fall 2014.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--